

Araknis x00 Series Wireless Access Points

Firmware Release Notes



Firmware v2.2.01 Release Notes

Release Details

Release Date	2025/06/04
Firmware Version	2.2.01
Product SKUs Affected	AN-700-AP-O-AC

Fixes

- Resolved cybersecurity issues.

Firmware v2.2.00 Release Notes

Release Details

Release Date	2022/01/27
Firmware Version	2.2.00
Product SKUs Affected	AN-500-AP-I-AC AN-700-AP-I-AC AN-700-AP-O-AC

Pro Tip: Clear browser cache & settings prior to and after the firmware upgrade.

Resolved Functional/Local Issues

- Fixed FragAttacks vulnerability in WPA. Visit fragattacks.com for more info.
- Fixed a Site Survey issue where scanned APs reported an incorrect wireless type.

Firmware v2.1.02 Release Notes

Release Details

Release Date	2021/10/06
Firmware Version	2.1.02
Product SKUs Affected	AN-500-AP-I-AC AN-700-AP-I-AC AN-700-AP-O-AC

Pro Tip: Clear browser cache & settings prior to and after the firmware upgrade.

Resolved Cloud Issues

- Fixed issue where the web UI would not load via webconnect after a firmware upgrade.

Resolved Functional/Local Issues

- Fixed issue where Device names in the client list would load only a portion of devices after a reset of the device.
- Fixed issue where Encryption status in the Wireless Networks table would show as 'Undefined'.
- Fixed a command injection vulnerability with the ping and trace-route tools.
- Fixed band-steering issue where band-steering would not work when using certain special characters in the SSID name.
- Fixed issue where band-steering becomes disabled during upgrade.
- Fixed issue where the connected clients TX/RX counters reset after 4GB of data.
- Fixed pop-up language when restarting the device via the local UI.
- Fixed issue with DNS server where both primary and secondary DNS addresses were required to save the setting.
- Fixed issue where the local UI's password would be displayed in plain text via CLI.
- Fixed the web access tooltip under the Access Control feature.
- Fixed the bonjour toggle tooltip under the Device Discovery feature.
- Fixed client isolation tooltip under SSID configuration.
- Fixed issue where the downloaded configuration file showed the users' login credentials.
- Fixed issue, where in some cases, when upgrading from v.1.3 firmware to the latest, the AP changed the WiFi security.
- Fixed issue where the failsafe recovery password that was being accepted was not the most recently configured on the system.
- Fixed issue where upon firmware update, the guest network would stop passing internet unless a restart was issued post-update.

Firmware v2.0.02 Release Notes

Release Details

Release Date	2019/10/31 (indoor) —or— 2020/01/21 (outdoor)
Firmware Version	2.1.02
Product SKUs Affected	AN-500-AP-I-AC AN-700-AP-I-AC AN-700-AP-O-AC

Important: Restart the AP *prior* to applying this firmware.

Pro Tip: Clear browser cache & settings prior to and after the firmware upgrade.

Added/Removed Features

- Updated local UI look and feel for greater consistency across Araknis WAP.
- Updated user accounts / user access to accommodate password law constraints set by California's IoT security legislation.

Resolved Cloud Issues

- Implemented long-term improvement for persistent OvrC connectivity.

Resolved Functional/Local Issues

- Improved functionality for environments that experience periodic loss of internet and/or device connectivity.
- Improved functionality for environments that experience WAP reboots and/or slowed throughput.
- Improved compatibility with wireless iOS devices.
- Fixed DST and time-zone related settings around configuration adjustments.
- Updated browser tab name. It now references the specific SKU on the local UI tab.
- Updated certificate requirements to accommodate use of the local UI with MacOS 13 (Catalina). See <https://support.apple.com/en-is/HT210176>

Firmware v2.0.00 Release Notes

Release Details

Release Date	2018/10/18
Firmware Version	2.0.00
Product SKUs Affected	AN-700-AP-I-AC

Added/Removed Features

- Updated Wireless Driver for optimized client communication.
- Updated SDK and Kernel for better packet processing and to ensure stability of the AP.

Resolved Functional/Local Issues

- Fixed OvrC connectivity issue by adding a DNS watchdog.
- Updated device communication with the server to include status information like RX/TX and client MAC address.

MAJOR Resolved Local UI Issues

- The AN-700 AP no longer randomly reboots.
- Fixed issue that caused the AP to perform sluggishly (latency and throughput) when devices are connected for long periods of time with a high data rate.
- Fixed issue wherein certain devices could not connect or would not stay connected to the AP (particularly optimized for IoT Devices).
- WAP now consistently hands out DHCP addresses from the router.

Minor Resolved Local UI Issues

- Fixed issue wherein the AP would receive a previously set manual time upon reboot of the device.
- Improved System Log through removal of unnecessary SDK-related status entries.

Firmware v1.3.02 Release Notes

Release Details

Release Date	2017/12/12
Firmware Version	1.3.02
Product SKUs Affected	AN-100-AP-I-N AN-300-AP-I-N AN-500-AP-I-AC AN-700-AP-O-AC AN-700-AP-I-AC

Resolved Functional/Local Issues

- Fixed the known issue in the 1.3.00 KRACK FW Patch; wherein the AP would lock up if its LAN port were manually configured as a 10/100M connection.

Firmware v1.3.00 Release Notes

Release Details

Release Date	2017/11/09
Firmware Version	1.3.00 - PATCH
Product SKUs Affected	AN-100-AP-I-N AN-300-AP-I-N AN-500-AP-I-AC AN-700-AP-O-AC AN-700-AP-I-AC

Resolved Functional/Local Issues

- Fixed a vulnerability allowing for Key Reinstallation Attacks (KRACK) that could jeopardize the security of all information travelling to and from the access point wirelessly.

Known Issues

- **Cause:** Manually configuring the LAN port to be a 10/100M connection.
- **Result:** The AP locks up and stops passing traffic.
- **Workaround:** Restart the access point after applying settings via a remotely controlled power outlet or PoE Switch.

Note: A passive fix for this issue is coming, but we expect the vast majority of you will find this FW release to be an important and acceptable patch against the notorious KRACK vulnerability.

Firmware v1.2.00 Release Notes

Release Details

Release Date	2017/09/11
Firmware Version	1.2.00
Product SKUs Affected	AN-100-AP-I-N AN-300-AP-I-N AN-500-AP-I-AC AN-700-AP-O-AC

Resolved Functional/Local Issues

- Removed the “Encryption Key” field from WPS settings for security reasons.
- Fixed issue with SNMP where all ports reported 10Mbps connection speed when they were negotiated otherwise.
- Fixed issue with VLANs settings where if the user tried to save a value outside the acceptable range, the router would throw an error but also incorrectly default the value to 51 or 1. Now defaults to a null value.
- Fixed information bubble for “Status” under the Auto-Reboot section. Bubble now states, “It takes 2-3 minutes to fully boot”.
- Fixed issue on the Wireless Settings page where “advanced search” would display as an option when, in reality, it is not a functionality the WAP supports. The field is no longer displayed.
- Fixed issue with Bonjour where the Araknis AP’s name would not show up in a Fing scan. Now, Bonjour is enabled by default.
- Fixed issue with the 700 indoor AP not passing client device DHCP requests on to the router.
- Fixed issue with formatting on the LAN page IP Settings table; had mismatched coloring.
- Fixed issue with Fast Roaming hand-off, would not occur effectively when installing the access points at close range with multiple SSIDs. Now an adjusted beacon interval permits good performance at both short and long distances.
- Fixed issue with Admin Password when using a special character (\$) in the password would cause the system to parse out the \$ and everything after it.

Resolved Cloud Issues and Features

- Added functionality to support new and upcoming feature-sets in the OvrC UI.
- Removed duplicate client list information from 60sec OvrC updates.

Firmware v1.1.14 Release Notes

Release Details

Release Date	2017/06/22
Firmware Version	1.1.14
Product SKUs Affected	AN-100-AP-I-N AN-300-AP-I-N AN-500-AP-I-AC AN-700-AP-O-AC

New Features

- Added feature to disable/enable broadcasting of the repeater SSID on any given WAP.
- Added feature wherein you can now configure the radio power levels independently for each radio, 2.4 or 5GHz.

Resolved Functional/Local Issues

- Fixed issue wherein WAPs ran over 90% memory utilization with normal process. This will help ensure the WAP operates consistently over time.
- Fixed issue wherein the AN-300-AP prompts the user that a configuration change is ready when actually there is no change.
- Fixed issue where the system name could be modified by OvrC to be invalid, preventing DHCP addresses from being handed out.
- Fixed issue where a node is established per each new connection, filling up the system log. Now, this log is not provided as it is inconsequential.
- Fixed issue where the help bubble for Araknis EZ Access does not display dynamically according to system name that is configured.
- Fixed issue wherein the WAP logs on FW 1.1.10 and above have not been reporting most system activity. Now reports more information per system operation.
- Fixed issue when running multiple 2.4 and 5GHz networks, that one or more would not broadcast consistently. This was a band-steering related issue that has since been solved.
- Fixed the input limits on the traffic shaping feature to be accurate to what the WAP can do per radio.
- Fixed issue where the MAC filter schedule was shared between both allow and deny lists. Now the lists are unique.

Resolved Cloud Issues

- Fixed issue where when changing the SSID via OvrC, only one radio would change, not both when both would be applicable.
- Fixed issue where if the "\$" is used in a SSID password sent from OvrC, then the password is truncated.

Firmware v1.1.10 Release Notes

Release Details

Release Date	2016/05/31
Firmware Version	1.1.10
Product SKUs Affected	AN-100-AP-I-N AN-300-AP-I-N

New Features

- Changed the system log to only log messages more urgent than level 4(error).
- Resolved Functional/Local Issues
- Fixed issue with the traffic shaping limits on respective WAP SKUs. Now in line with what the WAP is actually capable of doing.
- Fixed issue where if VLANs are established per SSID, then traffic shaping rules aren't properly applied.
- Fixed issue where clicking on WPS in the left navigation bar created a configuration change.
- Fixed issue where the file window for upload configuration on the file management page will not close on the Edge browser.
- Fixed issue where clients connected to the guest network always show in the client list as offline, even when they are online.

Resolved Cloud Issues

- Fixed issue where the client list found in OvrC would not report 2.4 GHz clients when band steering was enabled on the access point.
- Fixed issue with properly displaying VLAN ID and configuration options on OvrC. Now displays properly.

Known Cloud Issues

- If you are configuring an SSID in the OvrC app, when using certain special characters, particularly "\$", passwords may be truncated. We suggest avoiding the use of special characters in SSID passwords when using OvrC for setup until we resolve this issue in a future release.

Technical Support

For chat and telephone, visit tech.control4.com/s/contactsupport • Email: TechSupport@SnapOne.com. Visit tech.control4.com for discussions, instructional videos, news, and more.

Warranty and Legal Notices

Find details of the product's Limited Warranty at snapone.com/legal/ or request a paper copy from Customer Service at **866.424.4489**. Find other legal resources, such as regulatory notices and patent and safety information, at snapone.com/legal/.

Copyright ©2025, Snap One, LLC. All rights reserved. Snap One its respective logos are registered trademarks or trademarks of Snap One, LLC (formerly known as Wirepath Home Systems, LLC), in the United States and/or other countries. 4Store, 4Sight, Control4, Control4 My Home, SnapAV, Araknis Networks, BakPak, Binary, Dragonfly, Episode, Luma, Mockupancy, Nearus, NEEO, Optiview, OvrC, Pakedge, Sense, Strong, Strong Evolve, Strong VersaBox, SunBriteDS, SunBriteTV, Triad, Truvision, Visualint, WattBox, Wirepath, and Wirepath ONE are also registered trademarks or trademarks of Snap One, LLC. Other names and brands may be claimed as the property of their respective owners. Snap One makes no claim that the information contained herein covers all installation scenarios and contingencies, or product use risks. Information within this specification subject to change without notice. All specifications subject to change without notice.